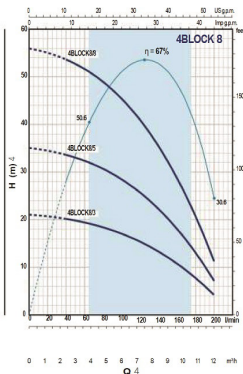
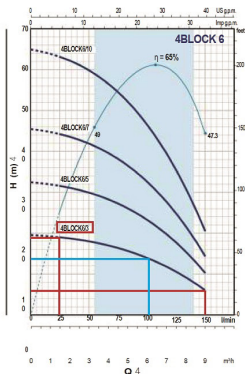


CURBE DE FUNCTIONARE

 50 Hz n= 2900 min⁻¹


4BLOCK 6

TIP	PUTERE (P2)		Q m³/h l/min	0	1.5	2.4	3.6	4.5	6.0	7.5	9.0
Monofazic	kW	HP		0	25	40	60	75	100	125	150
4BLOCKm 6/3	0.37	0.50	H metri	19.5	19	18.4	17.4	16.4	14	10.6	6
4BLOCKm 6/5	0.55	0.75		32.5	31.5	30.5	29	27.5	23.3	17.7	10
4BLOCKm 6/7	0.75	1		45.5	44	43	40.5	38	32.5	24.8	14.5
4BLOCKm 6/10	1.1	1.5		65	63	61.5	58	54.5	46.5	35.5	20.5

4BLOCK 8

TIP	PUTERE (P2)		Q m³/h l/min	0	2.4	3.6	4.5	6.0	7.5	9.0	10.5	12
Monofazic	kW	HP		0	40	60	75	100	125	150	175	200
4BLOCKm 8/3	0.55	0.75	H metri	21	20	19.4	18.7	17.1	14.9	12.1	8.6	4
4BLOCKm 8/5	0.75	1		35	33.5	32.5	31	28.5	24.8	20.2	14.3	7
4BLOCKm 8/8	1.1	1.5		56	53.5	51.5	50	45.5	39.5	32.5	22.9	11.5

Q = Debit H = înaltime de pompare manometrice totale

Toleranțe curbelor de funcționare conform EN ISO 9906 Grad B8.