

INFORMATION LETTER

No. 90 Zijin Rd., New District, Suzhou, 215011, China
<https://en.goodwe.com>

Information Letter 25001

SUBJECT: Lynx D Battery New & Old Power Terminal Compatible Solution Notice


AFFECTED: Lynx D (The first three digits are 50G, and the tenth digit is D)

Background

Customers need to make their own wires to fix the battery DC terminals. Poor crimping may cause installation risks, so Lynx D battery has introduced a new power terminal (HD terminal).

- Old battery part number BST0051-01-00P, using old terminals, Dianwei brand, customers need to manually crimp and connect the wires;
- New battery part number BST0051-08-00P, using new terminals, HD brand, customers only need to strip the wires and lock them.

Terminals:

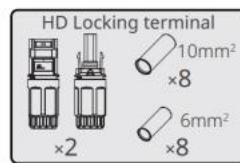

Tools:



Old version

New version

Because customers will choose wall-mounted or stacked according to different installation methods, the power terminals of the batteries are placed in the wall-mounted accessory package and the base installation package, so the wall-mounted accessory package and the base installation package are also divided into new and old.


Type	Old Part Number Dianwei terminal	New Part Number HD terminal
Base package	SIB0724-00-00P	ACS0021-00-00P
Wall mounting rack package	SIB0725-00-00P	ACS0022-00-00P

However, since more than 6,000 Lynx D with the old terminal configuration have been shipped, importing the LXD with HD terminal will cause the Lynx D battery installation of the old and new terminals to be incompatible when expanding or replacing the batteries.


Solutions

Scenario 1 The customer's **base accessory package SIB0724-00-00P or Wall mounting rack package SIB0725-00-00P (with the old battery terminal)** needs to be matched with a new HD

terminal battery. The new HD terminal accessory package(**SIB1189-00-00P**) needs to be obtained in advance.

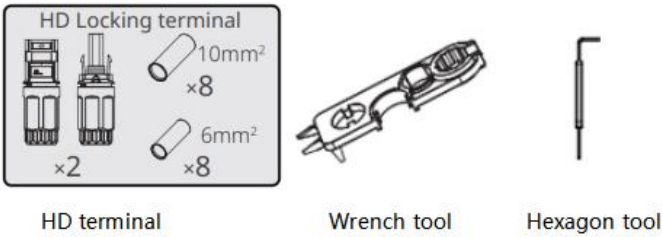

Scenario 2 If a customer receives a **new base accessory package ACS0021-00-00P or Wall mounting rack package ACS0022-00-00P (including HD terminals)** and a battery package with old battery terminals, they need to obtain an **adapter cable(SIB1188-00-00P, including Positive cable x1pcs 306-60247-02, Negative cable x1pcs 306-60246-02)** in advance.

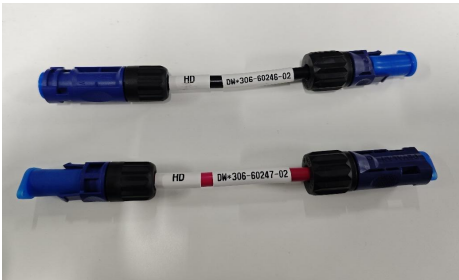

Adapter terminal diagram



Adapter Installation.mp4

Installation Video

Scenario 3 The customer needs to **expand the capacity of batteries with old terminal** and purchase new batteries(with HD terminal) from sales or distributors. A adapter cable is required to connect the new and old batteries. So customers need to obtain the **adapter cable(SIB1188-00-00P)** in advance.

Appendix

List of new and old terminal battery packs and accessory packs part number

Type	Old Part Number Dianwei terminal	New Part Number HD terminal
Lynx D battery package	BST0051-01-00P	BST0051-08-00P
Base package	SIB0724-00-00P	ACS0021-00-00P
Wall mounting rack package	SIB0725-00-00P	ACS0022-00-00P
Adapter cable	SIB1188-00-00P Positive cable x1pcs (306-60247-02) Negative cable x1pcs (306-60246-02)	
HD Terminals and Tools	SIB1189-00-00P	

Carey Chen
10th Feb 2025